

## IMMEDIATE ACTION REQUIRED BULLETIN


Tuesday, April 17, 2018

Please copy and distribute to superintendents and all personnel affected.

**Equipment:** Endura Controller

**Problem:** Wiring error on the bucher power supply harness (Con 1 pin 3 on 6300AFH board). While on inspection the car could move at near 70 FPM in the down direction. Reference Gensuite #20126.

**Solution:** Inspect that CON1 Pin 6 is connected to Pin 4 on the bucher power supply. Correct if mis-wired.

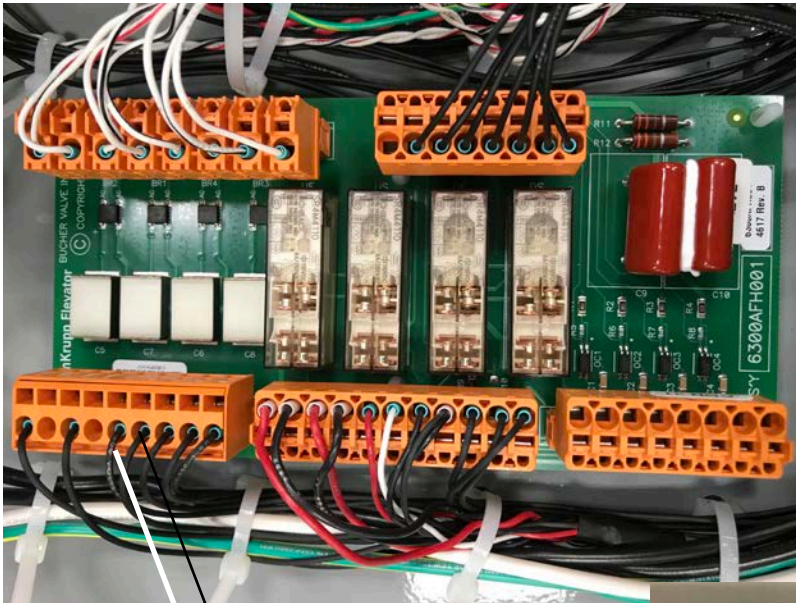

Confirm CON1 Pin 6 is connected Pin 4 on power supply.



Warranty credit given up to one (1) mechanic hour per unit for reimbursement. thyssenkrupp Elevator reserves the right to refuse claims received after 08/30/2018. Failure to comply with this bulletin may affect future warranty claims.

*All work described in this bulletin must be performed in accordance with provisions described in the thyssenkrupp Elevator Corporation Safety Manual. All work must conform to the Local and National Code provisions in effect in your area. This Bulletin is for Internal Use Only.*

This and all published Manufacturing Bulletins are available on the [Lobby](#) and [TKE WIKI](#)